



Before use, connect the cart to the mains with the supplied spiral cable and let the battery charge until the LED indicator stops flashing (100%).

The PC can be started with the on/off switch at the back/top of the cart.


- Briefly press the push button, the white LED lights up and the device is switched on.
- To switch off the device: briefly press the push button again.
- The white LED will now flash and the PC will shut down.
- The unit will turn off after 1 minute.
- To turn off the device and the PC: press and hold the button for 3 seconds.

We recommend switching the PC on/off via the on/off button on the back/top of the cart. In this way Windows will be closed correctly (the same with a deeply discharged battery). If the PC is still shut down via Windows and you wish to restart the PC, follow the following procedure:

- Press the on/off button once
- Wait 30 seconds until the LED of the button lights up
- Press the on/off button a second time
- The PC will reboot.

» Battery status display - first generation

The COW controller PCB in the cart displays the remaining battery charge by means of a LED indicator on the top of the cart and the Battery Monitor application on the PC screen (only when the application is installed). You can access this application by opening it via the icon at the bottom right of the screen.

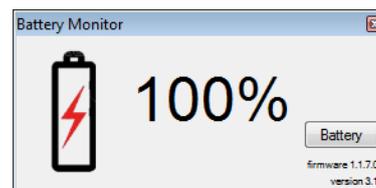


» LED indication

		The battery has a charge between 100% and 70%. The LED flashes when the Medicart is connected to the mains. Charge the battery as many times as possible until the LED indicator stops flashing. The battery is then 100% charged.
		The battery has a charge between 69% and 40%.
		The battery has a charge between 39% and 10%. Frequent use of the Medicart with a battery percentage of 30% or less significantly shortens the battery life.
		The battery has a charge of less than 10% when the LED flashes red quickly. Immediately connect the Medicart to the mains and let the battery charge to 100%!

» Battery status display - 2nd generation

The COW Controller PCB in the cart displays the remaining battery charge by means of an LED indicator on the top of the cart and the Battery Monitor application on the PC screen (only when the application is installed). You can access this application by opening it via the icon at the bottom right of the screen.

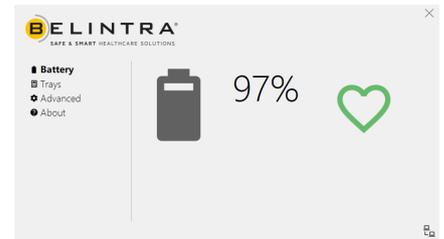

» LED indication

		on battery - SOC between 100% and 50%			on battery - SOC less than 9%
		on battery - SOC between 49% and 20%			in power socket - SOC less than 100%
		on battery - SOC between 19% and 10%			in power socket - SOC equal to 100%

* SOC = State Of Charge


» Display settings

To prevent the screen settings from being changed inadvertently, the OSD menu is always delivered locked. See the instruction below to lock and unlock the display menu. It is recommended to lock the screen menu again after the settings have been adjusted.

» MD24

To lock the OSD menu, press and hold the button while the LCD display is off, and then press the button to turn the LCD display on.

To unlock the OSD menu, press and hold the button while the LCD display is off, and then press the button to turn the LCD display on.

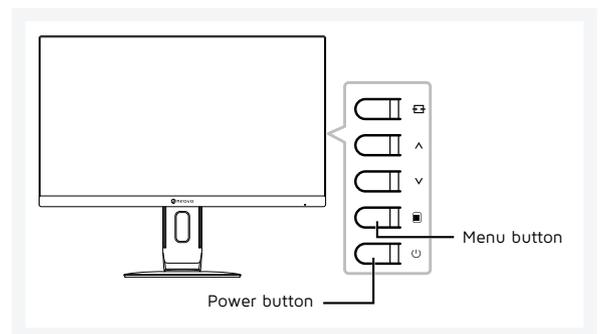

» X22 en X24

When the OSD is locked, all keypad buttons are inactivated.

Type of OSD Lock	Lock Operation	Unlock Operation
Lock all buttons	Touch and hold the , and the buttons for 5 seconds	Touch and hold the , and the buttons for 5 seconds or until the OSD menu appears

For detailed instructions on how to use the OSD menu, please refer to the manual of the display.

» Important Guidelines

- Adjust your speed to the immediate conditions when moving the cart. To maintain control of the cart during unexpected situations, you should never exceed a normal walking pace (2.5 to 3 mph).
- Make sure that no objects are loose on the cart when moving the cart.
- Make sure that the mains plug is pulled out before moving the carriage. Never pull on the cord. When disconnecting the power cord, do not hold the cord, but the plug.
- Advice to guarantee optimal battery life: Connect the cart to the mains power as often as possible. Charge the battery to 100% daily.

If you have any questions, please do not hesitate to contact our service desk at: support@belintra.com or +32 (0)9 389 00 10.